



MANUALE USO E MANUTENZIONE

OPERATING AND MAINTENANCE

TE senza supporto

INSTALLAZIONE

- Calettare i semigiunti sui rispettivi alberi bloccandoli con grani radiali o con rondelle di testa.
- Accostare i semigiunti fino ad inserire i pioli o i tasselli nelle rispettive sedi, rispettando le quote H a tabella.
- Controllare con comparatore, il parallelismo fra le facce e la perfetta coassialità dei semigiunti come indicato in (FIGURA 1).
- Controllare tramite comparatore il parallelismo fra i piani delle flange dei semigiunti nei punti A-B-C-D rispettivamente come indicato in (FIGURA 2).
- Eseguire il sopra detto controllo su ogni giunto della trasmissione ottenendo anche il controllo del disallineamento radiale ΔR fra gli alberi del motore della macchina condotta come indicato in (FIGURA 3).
- Dopo le operazioni di cui sopra si devono eseguire alcuni avviamenti di prova per poi ricontrollarne l'allineamento.
- Dopo la messa in marcia dell'impianto è indispensabile effettuare le stesse verifiche dopo 100 ore di funzionamento.

Disallineamento angolare:

$$\Delta W \leq 0.3^\circ [^\circ]$$

Disallineamento radiale:

$$\Delta R \leq F/1000 [\text{mm}]$$

Spostamento assiale:

$$\Delta H \pm 1 [\text{mm}]$$

MANUTENZIONE

- Si consiglia di verificare, in funzione all'esercizio lo stato di usura degli elementi elastici (ogni 500 ore di funzionamento).
- Nel caso in cui si fosse verificata un usura precoce si rende necessario verificare l'allineamento della trasmissione con comparatore come indicato in (FIGURA 2)

STOCCAGGIO

- Lo stoccaggio delle trasmissioni per lunghi periodi si deve eseguire proteggendo le parti lavorate, la bulloneria, le rondelle, i piolo di gomma racchiudendo il tutto con film di polietilene.

INSTALLATION

- Spline the half-joints to the corresponding shafts and block them with radial dowels or head washers.
- Move the half-joints till the stakes or the small blocks are in their seats according to H shown in the PICTURE hereinafter.
- Gauge the parallelism and the perfect concentricity of the half-joints as per (PICTURE 1).
- Then gauge the parallelism of the planes of the joint flanges at A-B-C-D respectively as per (PICTURE 2).
- The said gauging on each transmission joint permits also to check the radial misalignment ΔR between the shafts of the driven motor as shown in (PICTURE 3).
- Thereafter, make some start-up tests and then check again the alignment for correctness.
- After the plant actual start-up it is compulsory to carry out the same gauging after 100 hours of operation.

Angular misalignment:

$$\Delta W \leq 0.3^\circ [^\circ]$$

Radial misalignment:

$$\Delta R \leq F/1000 [\text{mm}]$$

Axial deviation:

$$\Delta H \pm 1 [\text{mm}]$$


MAINTENANCE

- It is recommended to check the wear of the lamellae elements based on their utilization (every 500 hours of operation).
- In case of early wear, it is necessary to gauge the joint alignment as shown in (PICTURE 2)


STORAGE

- Should half-joints require long storage, the machined elements, screws, washers and small rubber blocks shall be wrapped in a polyethylene film.

(FIGURA 1) - (PICTURE 1)

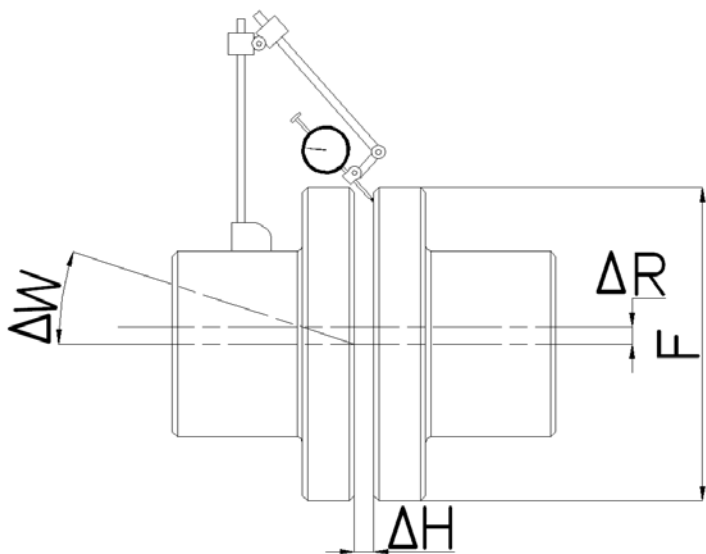

(FIGURA 2) - (PICTURE 2)

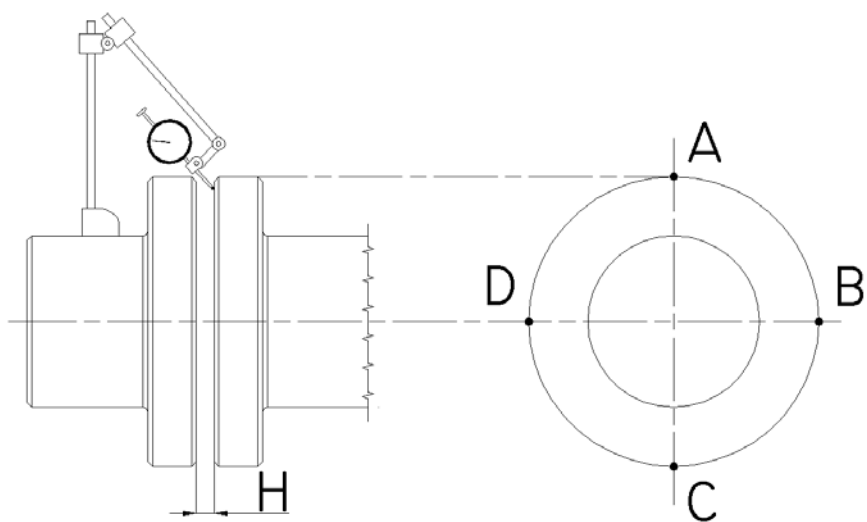

(FIGURA 3) - (PICTURE 3)

